Approved CR

IAA Albuquerque
4400 Broadway Blvd SE
Branch No 140
Albuquerque, NM 87105
(505) 873-2081/(505) 873-3029
WHOLESALE ASSESSMENT ONLY

Make/Model:	**2024 NISSAN TITAN**
Bodystyle/Series:	**Crew Cab SV 4X4**
Color:	**Gray**
Mileage:	**12,926 (Verified)**
Turn-in Mileage:	-
VIN:	**1N6AA1EC5RN109030**
Work Order/ Stock Number:	**46190567**
Customer:	GSA Fleet Vehicle Sales 1800 F Street NW Washington, DC 20405 fleetsalessupport@gsa.gov
Client Stock #:	**G62-A2495**
Vehicle Grade :	**Grade 0.8**
Remarks:	-
Announcements:	• SALVAGE TITLE
Certification :	-
Req. Prev. Repair Order:	-



Drivable: No

Equipment

Transmission:	**Automatic Transmission**	A/C:	**No**
Engine:	**8-Cylinder Gas**	Cruise Control:	**Yes**
Engine Size:	**5.6 L**	Pwr Steering:	**Yes**
Roof:	**Hard Top**	Pwr Locks:	**Yes**
Radio:	-	Pwr Windows	**Yes**
Interior - Type/Color:	**Cloth Interior /BLACK**	Rear Defroster:	**No**
Airbag:	**Driver Side Air Bag**	Tilt Steering:	**Yes**
Seats:	**Bench**	Drive Type:	**4-Wheel Drive**
Seat Count:	-	Brakes:	**Disc**

Equipment

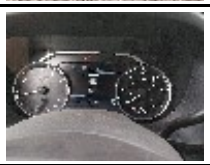
Additional Equipment:

Car Tire Size - RR 265 / 70 R 18	Car Tire Size - RF 265 / 70 R 18	Car Tire Size - LF 265 / 70 R 18
Car Tire Size - LR 265 / 70 R 18	LF Tires - 16/32 inch	LR Tires - 16/32 inch
RF Tires - 16/32 inch	RR Tires - 16/32 inch	Tire Brand - Front Left - HERCULES
Tire Brand - Front Right - HERCULES	Tire Brand - Rear Left - HERCULES	Tire Brand - Rear Right - HERCULES
Tire Model - LF - Terra Trac A/T	Tire Model - LR - Terra Trac A/T	Tire Model - RF - Terra Trac A/T
Tire Model - RR - Terra Trac A/T		

Non Chargeable Damages

Photo	Item	Damage	Action	Severity
	Right Side Panel	Photo Only	-	-
	Left Side Panel	Photo Only	-	-
	Instrument Panel	Photo Only	-	-
	Rear Bumper	Photo Only	-	-
	Extra Photo 2	Photo Only	-	-
	Extra Photo 3	Photo Only	-	-
	Right Front Fender	Photo Only	-	-
	Extra Photo 4	Photo Only	-	-

Non Chargeable Damages

Photo	Item	Damage	Action	Severity
	Extra Photo 5	Photo Only	-	-
	Extra Photo 6	Photo Only	-	-
	Extra Photo 7	Photo Only	-	-
	Left Front Fender	Photo Only	-	-
	Left Rear Bumper/Cover	Photo Only	-	-
	Right Rear Bumper/Cover	Photo Only	-	-
	Photo - Dash	Photo Only	-	-
	Extra Photo 1	Photo Only	-	-
	Odometer	Photo Only	-	-
	Rear Seats	Photo Only	-	-
	Front Cover Center	Photo Only	-	-

Non Chargeable Damages

Photo	Item	Damage	Action	Severity
	Keys	Photo Only	-	-
	Engine	Photo Only	-	-
	Photo - Vin/Id Sticker	Photo Only	-	-
	Right A Pillar	Kinked	-	> 12 Inches
	Warning Light - Engine	On	-	Unacceptable
	Warning - Traction Control	On	-	Unacceptable
	Warning - Collision Avoidance	On	-	Unacceptable

Non Chargeable Damages

Photo	Item	Damage	Action	Severity
	Right Apron	Kinked	-	> 12 Inches

Chargeable Damages

Photo	Item	Damage	Action	Severity
	Grille Molding	Dent(S) W/ Paint Dmg	-	Replacement Required
	Hood	Dent(S) W/ Paint Dmg	-	8 To 9 Inches
	Frt Washer Reservoir	Broken	-	Replacement Required
	Right Front Wheel	Curb Rash	-	> 12 Inches
	Right Front Door	Dent(S) W/ Paint Dmg	-	4 To 5 Inches

Chargeable Damages

Photo	Item	Damage	Action	Severity
	Right Tail Light	Broken	-	Replacement Required
	Rear Bumper	Broken	-	Replacement Required
	Tailgate	Dent(S) W/ Paint Dmg	-	1 To 2 Inches
	Right Front Wheel	Unattached	-	Unacceptable
	Right Front Fender	Severe Damage	-	Replacement Required
	Rf Axle Assembly	Broken	-	Replacement Required

Chargeable Damages

Photo	Item	Damage	Action	Severity
	Front Bumper	Severe Damage	-	Replacement Required
	Right Head Lamp	Missing	-	Replacement Required

File Insurance Claim? - Additional Damages and Remarks: -

DISCLAIMER. THIS CONDITION REPORT IS FOR INFORMATIONAL PURPOSES ONLY AND IS BASED ON INFORMATION PROVIDED BY THE SELLER. THIS CONDITION REPORT IS NEITHER INTENDED, NOR SHOULD IT BE CONSTRUED TO CONSTITUTE, ANY TYPE OF WARRANTY, WHETHER EXPRESS OR IMPLIED, INCLUDING WITHOUT LIMITATION ANY WARRANTY OF MERCHANTABILITY, AND ANY SUCH WARRANTY, WHETHER ARISING BY OPERATION OF LAW OR OTHERWISE, IS HEREBY DISCLAIMED. ANY REPUBLISHING OF THIS CONDITION REPORT SHALL CONTAIN THIS DISCLAIMER.