Approved CR

IAA Indianapolis
3302 South Harding Street
Branch No 541
Indianapolis, IN 46217
(317) 787-3202/(317)783-0586
WHOLESALE ASSESSMENT ONLY

Make/Model:	**2019 FORD F-250**
Bodystyle/Series:	**Crew Cab XL**
Color:	**White**
Mileage:	**19,308 (Verified)**
Turn-in Mileage:	-
VIN:	**1FT7W2B63KEC55791**
Work Order/ Stock Number:	**46497064**
Customer:	GSA Fleet Vehicle Sales 1800 F Street NW Washington, DC 20405 fleetsalessupport@gsa.gov
Client Stock #:	**G630026X**
Vehicle Grade :	**Grade 2.2**
Remarks:	-
Announcements:	-
Certification :	-
Req. Prev. Repair Order:	-



Drivable: Yes

Equipment

Transmission:	**Automatic Transmission**	A/C:	**No**
Engine:	**8-Cylinder Gas**	Cruise Control:	**Yes**
Engine Size:	**6.2 L**	Pwr Steering:	**Yes**
Roof:	**Coach**	Pwr Locks:	**Yes**
Radio:	-	Pwr Windows	**Yes**
Interior - Type/Color:	**Cloth/Vinyl /GRAY**	Rear Defroster:	**No**
Airbag:	**Driver Side Air Bag**	Tilt Steering:	**Yes**
Seats:	**Bench**	Drive Type:	**4-Wheel Drive**
Seat Count:	-	Brakes:	**Anti Lock Brakes**

Equipment

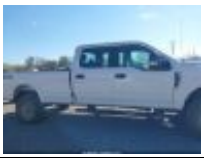
Additional Equipment:

Car Tire Size - LF 35 / 12.5 R 17	Car Tire Size - LR 35 / 12.5 R 17	Car Tire Size - RR 35 / 12.5 R 17
Car Tire Size - RF 35 / 12.5 R 17	LF Tires - 12/32 inch	LR Tires - 10/32 inch
RF Tires - 11/32 inch	RR Tires - 11/32 inch	Tire Brand - Front Left - MUD CLAW
Tire Brand - Front Right - MUD CLAW	Tire Brand - Rear Left - MUD CLAW	Tire Brand - Rear Right - MUD CLAW
Tire Model - RR - Mud Claw Comp MTX	Tire Model - RF - Mud Claw Comp MTX	Tire Model - LR - Mud Claw Comp MTX
Tire Model - LF - Mud Claw Comp MTX		

Non Chargeable Damages

Photo	Item	Damage	Action	Severity
	Right Front Fender	Photo Only	-	-
	Left Front Fender	Photo Only	-	-
	Left Rear Bumper/Cover	Photo Only	-	-
	Right Rear Bumper/Cover	Photo Only	-	-
	Photo - Dash	Photo Only	-	-
	Extra Photo 1	Photo Only	-	-
	Odometer	Photo Only	-	-
	Rear Seats	Photo Only	-	-

Non Chargeable Damages

Photo	Item	Damage	Action	Severity
	Photo - Vin/Id Sticker	Photo Only	-	-
	Engine	Photo Only	-	-
	Keys	Photo Only	-	-
	Front Cover Center	Photo Only	-	-
	Right Side Panel	Photo Only	-	-
	Left Side Panel	Photo Only	-	-
	Instrument Panel	Photo Only	-	-
	Rear Bumper	Photo Only	-	-
	Extra Photo 2	Photo Only	-	-
	Extra Photo 3	Photo Only	-	-

Chargeable Damages

Photo	Item	Damage	Action	Severity
	Hood	Chipped	-	2
	Right Front Fender	Multiple Scratches Light	-	4
	Right Front Door	Heavy Scratch	-	1 To 2 Inches
	Right Front Wheel	Corrosion	-	3 To 4 Inches
	Right Rear Door	Dent(S) W/ Paint Dmg	-	2 To 3 Inches
	R Cab Corner Panel	Broken	-	Replacement Required

Chargeable Damages

Photo	Item	Damage	Action	Severity
	Right Cab Side	Dent(S) W/ Paint Dmg	-	1 To 2 Inches
	Right Rear Wheel	Corrosion	-	3 To 4 Inches
	Rear Metal Bumper Chrome	Dent(S) W/No Paint Dmg	-	1/2 To 1 Inch
	Tailgate	Chipped	-	5
	Left Bed Side	Light Scratch	-	1 To 2 Inches
	Left Rear Wheel	Corrosion	-	8 To 9 Inches

Chargeable Damages

Photo	Item	Damage	Action	Severity
	Left Running Board	Scraped	-	9 To 10 Inches
	Left Front Wheel	Corrosion	-	5 To 6 Inches
	Roof	Enviro Paint Damage	-	> 12 Inches
	Right Front Seat Cushion	Torn	-	2 To 3 Inches
	Left Rear Seat Cushion	Torn	-	1/2 To 1 Inch
	Left Front Seat Cushion	Torn	-	> 12 Inches

Chargeable Damages

Photo	Item	Damage	Action	Severity
	Steering Wheel	Worn	-	Replacement Required
	Tailgate Protective Cap	Missing	-	Replacement Required
	Right Running Board	Peeling	-	9 To 10 Inches

File Insurance Claim? - Additional Damages and Remarks: -

DISCLAIMER. THIS CONDITION REPORT IS FOR INFORMATIONAL PURPOSES ONLY AND IS BASED ON INFORMATION PROVIDED BY THE SELLER. THIS CONDITION REPORT IS NEITHER INTENDED, NOR SHOULD IT BE CONSTRUED TO CONSTITUTE, ANY TYPE OF WARRANTY, WHETHER EXPRESS OR IMPLIED, INCLUDING WITHOUT LIMITATION ANY WARRANTY OF MERCHANTABILITY, AND ANY SUCH WARRANTY, WHETHER ARISING BY OPERATION OF LAW OR OTHERWISE, IS HEREBY DISCLAIMED. ANY REPUBLISHING OF THIS CONDITION REPORT SHALL CONTAIN THIS DISCLAIMER.