Approved CR

Carriage Trade Auto Auction
1200 Ridge Pike
Conshohocken, PA 19428
215-CAR-SALE/(610) 834-8274
WHOLESALE ASSESSMENT ONLY



Make/Model:	**2019 FORD F-250**
Bodystyle/Series:	**Extended Cab XL**
Color:	**WHITE**
Mileage:	**60,204 (Digital)**
Turn-in Mileage:	-
VIN:	**1FD7X2B68KEC15893**
Work Order/ Stock Number:	**0181606**
Customer:	GSA Fleet Vehicle Sales 1800 F Street NW Washington, DC 20405 fleetsalessupport@gsa.gov
Client Stock #:	**G632809V**
Vehicle Grade :	**Grade 2.7**
Remarks:	-
Announcements:	• CEL - BODY/PAINT DAMAGE ENG LIGHT P0451
Certification :	**Not Certified**
Req. Prev. Repair Order:	-

Drivable: Yes

As Is 100K Miles: NO

Equipment

Transmission:	**Automatic Transmission w/ Overdrive**	A/C:	**Yes**
Engine:	**8-Cylinder Gas**	Cruise Control:	**No**
Engine Size:	**6.2 L**	Pwr Steering:	**Yes**
Roof:	**Hard Top**	Pwr Locks:	**Yes**
Radio:	-	Pwr Windows	**No**
Interior - Type/Color:	- **/GRAY**	Rear Defroster:	**No**
Airbag:	**Driver Side Air Bag**	Tilt Steering:	**No**
Seats:	**Bench**	Drive Type:	**4-Wheel Drive**
Seat Count:	**0**	Brakes:	**Power Brakes**

Equipment

Additional Equipment:

4th Passenger Door	Automatic Headlights	Auxiliary Pwr Outlet
Backup camera and monitor	Bench Seating	Bluetooth Connection
Brake Assist System	Car LF Tires - 8/32 inch	Car LR Tires - 14/32 inch
Car RF Tires - 8/32 inch	Car RR Tires - 6/32 inch	Car Tire Size - LF: LT245/75R17 LR: LT245/75R17 RF: LT245/75R17 RR: LT245/75R17
Cylinders - 8	Daytime Running Lights	Driver Adjustable Lumbar
Driver Restriction Features	Electrochromic Rearview Mirror	Electronic Stability Control
Engine Immobilizer	Front Head Air Bag	Front Tow Hooks
Ignition Key - 2key(s)	Independent Climate Control	Intermittent Wipers
LF Tires - 8/32 inch	LR Tires - 14/32 inch	Limited Slip Differential
Misc. Special Features - Passenger Third Door, Airbag Disconnect Switch	Pass. Air Bag	Passenger Vanity Mirror
Privacy Glass	RF Tires - 8/32 inch	RR Tires - 6/32 inch
Rear Bench Seat	Rear Head Air Bag	Running Board
Side Airbags - Front	Smart Device Integration	Steering Wheel Audio Control
Telematics	Tilt Steering Wheel	Tire LF - 8/32 inch
Tire Pressure Monitor System	Tire RF - 8/32 inch	Tire Size - LF: LT245/75R17 LR: LT245/75R17 RF: LT245/75R17 RR: LT245/75R17
Tire Size - LF: LT245/75R17 LR: LT245/75R17 RF: LT245/75R17 RR: LT245/75R17	Tow Hitch	Transmission - Automatic Transmission w/ Overdrive
Transmission - Automatic Transmission	Trip Computer	Wheels Front Left - Steel
Wheels Front Right - Steel	Wheels Rear Left - Steel	Wheels Rear Right - Steel

Non Chargeable Damages

Photo	Item	Damage	Action	Severity
	Extra Photo 8	Photo Only	-	-
	Miscellaneous	Photo Only	-	-
	Miscellaneous	Photo Only	-	-

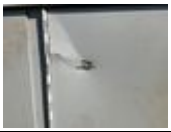
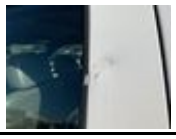
Non Chargeable Damages

Photo	Item	Damage	Action	Severity
	Miscellaneous	Photo Only	-	-
	Miscellaneous	Photo Only	-	-
	Miscellaneous	Photo Only	-	-
	Miscellaneous	Photo Only	-	-
	Miscellaneous	Photo Only	-	-
	Miscellaneous	Photo Only	-	-
	Extra Photo 1	Photo Only	-	-
	Extra Photo 2	Photo Only	-	-
	Extra Photo 3	Photo Only	-	-
	Extra Photo 4	Photo Only	-	-
	Extra Photo 5	Photo Only	-	-
	Extra Photo 6	Photo Only	-	-
	Extra Photo 7	Photo Only	-	-

Non Chargeable Damages

Photo	Item	Damage	Action	Severity
	Extra Photo 9	Photo Only	-	-

Chargeable Damages

Photo	Item	Damage	Action	Severity
	Front Bumper	Multiple Dents/Paint Damage	Estimate Only	5
	Grille	Cracked	Estimate Only	3 To 4 Inches
[no photo]	Hood	Multiple Scratches Light	Estimate Only	4
[no photo]	Left Front Door	Multiple Scratches Light	Estimate Only	4
	Left Bed Side	Dent(S) W/ Paint Dmg	Estimate Only	4 To 5 Inches
	Left Rear Door	Dent(S) W/ Paint Dmg	Estimate Only	3 To 4 Inches
	Rear Bumper	Peeling	Estimate Only	6 To 7 Inches
	Pickup Bed	Multiple Dents/Paint Damage	Estimate Only	7
[no photo]	Spare Tire	Missing	Replace	Replacement Required
	Right Bed Side	Hole(S)	Estimate Only	4 To 5 Inches
	Right Bed Side	Multiple Scratches Heavy	Estimate Only	4
[no photo]	Right Rear Door	Multiple Scratches Light	Estimate Only	4
[no photo]	Right Front Door	Multiple Scratches Light	Estimate Only	5
	Digital Display	Photo Only	Remove	None

Chargeable Damages

Photo	Item	Damage	Action	Severity
	Left Front Seat	Worn	Estimate Only	Replacement Required
	Right Front Seat	Torn	Estimate Only	1/2 To 1 Inch

File Insurance Claim? - Additional Damages and Remarks: -

DISCLAIMER. THIS CONDITION REPORT IS FOR INFORMATIONAL PURPOSES ONLY AND IS BASED ON INFORMATION PROVIDED BY THE SELLER. THIS CONDITION REPORT IS NEITHER INTENDED, NOR SHOULD IT BE CONSTRUED TO CONSTITUTE, ANY TYPE OF WARRANTY, WHETHER EXPRESS OR IMPLIED, INCLUDING WITHOUT LIMITATION ANY WARRANTY OF MERCHANTABILITY, AND ANY SUCH WARRANTY, WHETHER ARISING BY OPERATION OF LAW OR OTHERWISE, IS HEREBY DISCLAIMED. ANY REPUBLISHING OF THIS CONDITION REPORT SHALL CONTAIN THIS DISCLAIMER.