Approved CR

Carriage Trade Auto Auction
1200 Ridge Pike
Conshohocken, PA 19428
215-CAR-SALE/(610) 834-8274
WHOLESALE ASSESSMENT ONLY



| | |
|---|---|
| Make/Model: | **2017 FORD F-450 CHASSIS** |
| Bodystyle/Series: | **Extended Cab XL** |
| Color: | **WHITE** |
| Mileage: | **103,192 (Digital)** |
| Turn-in Mileage: | - |
| VIN: | **1FD9X4HY9HED88019** |
| Work Order/ Stock Number: | **0181604** |
| Customer: | GSA Fleet Vehicle Sales<br>1800 F Street NW<br>Washington, DC 20405<br>fleetsalessupport@gsa.gov |
| Client Stock #: | **G710374U** |
| Vehicle Grade : | **Grade 2.7** |
| Remarks: | - |
| Announcements: | • OVER 100K MILES - BODY/PAINT DAMAGE |
| Certification : | **Not Certified** |
| Req. Prev. Repair Order: | - |

Drivable: Yes

As Is 100K Miles: YES

## Equipment

| | | | |
|---|---|---|---|
| Transmission: | **Automatic Transmission w/ Overdrive** | A/C: | **No** |
| Engine: | **10-Cylinder Gas** | Cruise Control: | **No** |
| Engine Size: | **6.8 L** | Pwr Steering: | **Yes** |
| Roof: | **Hard Top** | Pwr Locks: | **Yes** |
| Radio: | **CD Only** | Pwr Windows | **No** |
| Interior - Type/Color: | **- /GRAY** | Rear Defroster: | **No** |
| Airbag: | **Driver Side Air Bag** | Tilt Steering: | **No** |
| Seats: | **Bench** | Drive Type: | **4-Wheel Drive** |
| Seat Count: | **0** | Brakes: | **Power Brakes** |

## Equipment

Additional Equipment:

| | | |
|---|---|---|
| 4th Passenger Door | Automatic Headlights | Auxiliary Audio Input |
| Auxiliary Pwr Outlet | Backup camera and monitor | Bench Seating |
| Bluetooth Connection | Brake Assist System | Car LF Tires - 12/32 inch |
| Car LR Tires - 7/32 inch | Car RF Tires - 13/32 inch | Car RR Tires - 7/32 inch |
| Car Tire Size - LF: LT225/70SR19.5 LR: LT225/70SR19.5 RF: LT225/70SR19.5 RR: LT225/70SR19.5 SP: FULL SIZE | Cylinders - 10 | Daytime Running Lights |
| Driver Adjustable Lumbar | Dual Rear Wheels | Electrochromic Rearview Mirror |
| Electronic Stability Control | Front Head Air Bag | Front Tow Hooks |
| Ignition Key - 2key(s) | Intermittent Wipers | LF Tires - 12/32 inch |
| LR Tires - 7/32 inch | MP3 Radio | Misc. Special Features - Passenger Third Door, Airbag Disconnect Switch |
| Mudflaps | Pass. Air Bag | Passenger Vanity Mirror |
| Privacy Glass | RF Tires - 13/32 inch | RR Tires - 7/32 inch |
| Rear Bench Seat | Rear Head Air Bag | Running Board |
| Side Airbags - Front | Smart Device Integration | Spare Tire - Full Size |
| Spare Tire Tread - 13/32 inch | Spare Wheel - Steel | Steering Wheel Audio Control |
| Telematics | Tilt Steering Wheel | Tire LF - 12/32 inch |
| Tire RF - 13/32 inch | Tire Size - LF: LT225/70SR19.5 LR: LT225/70SR19.5 RF: LT225/70SR19.5 RR: LT225/70SR19.5 SP: FULL SIZE | Tire Size - LF: LT225/70SR19.5 LR: LT225/70SR19.5 RF: LT225/70SR19.5 RR: LT225/70SR19.5 SP: FULL SIZE |
| Transmission - Automatic Transmission w/ Overdrive | Transmission - Automatic Transmission | Trip Computer |
| Wheels Front Left - Steel | Wheels Front Right - Steel | Wheels Rear Left - Steel |
| Wheels Rear Right - Steel | | |

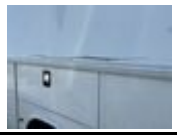
## Non Chargeable Damages

| Photo | Item | Damage | Action | Severity |
|---|---|---|---|---|
|  | Extra Photo 8 | Photo Only | - | - |
|  | Miscellaneous | Photo Only | - | - |

## Non Chargeable Damages

| Photo | Item | Damage | Action | Severity |
|---|---|---|---|---|
|  | Miscellaneous | Photo Only | - | - |
|  | Miscellaneous | Photo Only | - | - |
|  | Miscellaneous | Photo Only | - | - |
|  | Miscellaneous | Photo Only | - | - |
|  | Miscellaneous | Photo Only | - | - |
|  | Extra Photo 1 | Photo Only | - | - |
|  | Extra Photo 2 | Photo Only | - | - |
|  | Extra Photo 3 | Photo Only | - | - |
|  | Extra Photo 4 | Photo Only | - | - |
|  | Extra Photo 5 | Photo Only | - | - |
|  | Extra Photo 6 | Photo Only | - | - |
|  | Extra Photo 7 | Photo Only | - | - |
|  | Extra Photo 9 | Photo Only | - | - |

## Chargeable Damages

| Photo | Item | Damage | Action | Severity |
|---|---|---|---|---|
|  | Front Bumper | Multiple Dents/Paint Damage | Estimate Only | 10 Or More |
| [no photo] | Hood | Chipped | Estimate Only | 5 |
|  | Left Bed Side | Dent(S) W/ Paint Dmg | Estimate Only | 5 To 6 Inches |
|  | Left Bed Side | Hole(S) | Estimate Only | 2 To 3 Inches |
|  | Rear Bumper | Multiple Dents/Paint Damage | Estimate Only | 7 |
|  | Rear Door | Hole(S) | Estimate Only | 2 To 3 Inches |
|  | Right Cab Side | Dent(S) W/ Paint Dmg | Estimate Only | 5 To 6 Inches |
|  | Right Bed Side | Heavy Scratch | Estimate Only | > 12 Inches |
|  | Right Bed Side | Hole(S) | Estimate Only | 1 To 2 Inches |
| [no photo] | Right Front Fender | Multiple Scratches Light | Estimate Only | 3 |
|  | Digital Display | Photo Only | Remove | None |
|  | Vinyl Floor | Hole(S) | Estimate Only | 1 To 2 Inches |
|  | Left Front Seat | Worn | Estimate Only | Replacement Required |

File Insurance Claim? - Additional Damages and Remarks: -

DISCLAIMER. THIS CONDITION REPORT IS FOR INFORMATIONAL PURPOSES ONLY AND IS BASED ON INFORMATION PROVIDED BY THE SELLER. THIS CONDITION REPORT IS NEITHER INTENDED, NOR SHOULD IT BE CONSTRUED TO CONSTITUTE, ANY TYPE OF WARRANTY, WHETHER EXPRESS OR IMPLIED, INCLUDING WITHOUT LIMITATION ANY WARRANTY OF MERCHANTABILITY, AND ANY SUCH WARRANTY, WHETHER ARISING BY OPERATION OF LAW OR OTHERWISE, IS HEREBY DISCLAIMED. ANY REPUBLISHING OF THIS CONDITION REPORT SHALL CONTAIN THIS DISCLAIMER.