



Approved CR

Akron Auto Auction
2471 Ley Drive
Akron, OH 44319
3304365819/(330) 773-3921
lbeth@akronautoauction.com
WHOLESALE ASSESSMENT ONLY

Make/Model: **2018 JEEP
GRAND
CHEROKEE**

Bodystyle/Series: **4 Door Sport
Utility
Vehicle
LAREDO E
4D SUV 4WD**

Color: **SILVER**

Mileage: **80,050
(Verified, 6
digits)**

Turn-in Mileage: **-**

VIN: **1C4RJFAG6JC405329**

Work Order/
Stock Number: **000845649**

Customer: **GSA Fleet Vehicle Sales
1800 F Street NW
Washington, DC 20405
fleetsalesupport@gsa.gov**

Client Stock #: **G621731V**

Vehicle Grade : **Grade 2.5**

AutoGrade : **2.5 - Below
Average**

Remarks: **no
government
plates**

Announcements:

**• Former
Police Unit**

Certification : **Not Certified**

Req. Prev. Repair
Order: **-**



Drivable: Yes

UniBody/Frame Damage: NO As Is 100K Miles: NO

Equipment

Transmission:	Automatic Transmission	A/C:	Yes
Engine:	6-Cylinder Gas	Cruise Control:	Yes
Engine Size:	3.6 L	Pwr Steering:	Yes
Roof:	Hard Top	Pwr Locks:	Yes
Radio:	AM/FM Radio	Pwr Windows	Yes
Interior - Type/Color:	Cloth Interior /BEIGE	Rear Defroster:	Yes

Equipment

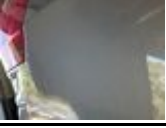
Airbag:	Dual Air Bags	Tilt Steering:	Yes
Seats:	Power	Drive Type:	4-Wheel Drive
Seat Count:	-	Brakes:	Power Brakes
Additional Equipment:			
4 Wheel Drive	4 Wheel Drive	ABS Brakes	
Air Conditioning	Automatic Headlights	Bluetooth Connection	
Brake Assist System	Car Tire Size - LF tire size P245/70SR17	Car Tire Size - RR tire size P245/70SR17	
Car Tire Size - RF tire size P245/70SR17	Car Tire Size - LR tire size P245/70SR17	Child Safety Locks	
Cruise Control	Cylinders - 6	Daytime Running Lights	
Driver Air Bag	Empty Weight - 4625 lb	Engine Immobilizer	
Floor Mats	Fog Lamps	Heated Front Seat(s)	
Heated Mirrors	Heated Steering Wheel	Independent Climate Control	
Intermittent Wipers	Keyless Entry	Keyless Start	
LF Tires - 9/32 inch	LR Tires - 9/32 inch	Leather Steering Wheel	
MP3 Radio	Master Key - 1key(s)	Motor Fuel Type - Gas	
Pass-Through Rear Seat	Pass. Air Bag	Power Brakes	
Power Driver Seat	Power Lock	Power Mirrors	
Power Steering	Power Windows	Privacy Glass	
RF Tires - 9/32 inch	RR Tires - 9/32 inch	Rear Defrost	
Rear Parking Aid	Rear Spoiler	Reverse Camera	
Seat Trim - Cloth	Side Airbags - Front	Spare Tire	
Steering Wheel Audio Control	Stereo - AM/FM Radio	Tilt Steering Wheel	
Tilt Wheel	Tire Pressure Monitor System	Traction Control	
Transmission - Automatic Transmission	Trip Computer	Wheels Front Left - Aluminium	
Wheels Front Right - Aluminium	Wheels Rear Left - Aluminium	Wheels Rear Right - Aluminium	
Woodgrain Interior Package			

Non Chargeable Damages

Photo	Item	Damage	Action	Severity
	Extra Photo 1	Photo Only	Estimate Only	Unknown
	Extra Photo 3	Photo Only	Estimate Only	Unknown

Non Chargeable Damages

Photo	Item	Damage	Action	Severity
	Photo - Interior	Photo Only	Estimate Only	Unknown
	Overall Picture - Odometer	Photo Only	Estimate Only	Unknown
	Extra Photo 2	Photo Only	Estimate Only	Unknown
	Roof	Photo Only	Estimate Only	Unknown
	Left Rear Seat	Photo Only	Estimate Only	Unknown
	Photo - Dash	Photo Only	Estimate Only	Unknown
	Steering Wheel	Photo Only	Estimate Only	Unknown
	Overall Picture - Engine	Photo Only	Estimate Only	Unknown
	Photo - Wheel	Photo Only	Estimate Only	Unknown
	Extra Photo 4	Photo Only	Estimate Only	Unknown
	Photo - Deck	Photo Only	Estimate Only	Unknown
	Photo - Vin/Id Sticker	Photo Only	Estimate Only	Unknown

Chargeable Damages				
Photo	Item	Damage	Action	Severity
	Left Front Wheel	Chipped	Repair	3
	Left Rear Door	Multiple Scratches Heavy	Repair	5
	Right Qtr Panel	Dent(S) W/ Paint Dmg	Repair	2 To 3 Inches
	Right Qtr Panel	Previous Repair	Refinish	Substandard Repair
	Rear Bumper	Multiple Scratches Heavy	Repair	4
	Right Front Door	Dent(S) W/ Paint Dmg	Repair	1/8 To 1/2 Inch
	Right Front Fender	Dent(S) W/ Paint Dmg	Repair	3 To 4 Inches
	Right Front Wheel	Chipped	Repair	2
	Right Rear Door Panel	Hole(S)	Report	1/8 To 1/2 Inch
	Right Rear Door	Multiple Dents/Paint Damage	Repair	4
	Right Rear Wheel	Chipped	Touch Up	1
[no photo]	Left Front Fender	Dent(S) W/No Paint Dmg	PDR	1/8 To 1/2 Inch
[no photo]	Left Rear Wheel	Chipped	Repair	2
	Center Console	Multiple Scratches Light	Touch Up	4

Chargeable Damages				
Photo	Item	Damage	Action	Severity
	Front Bumper	Chipped	Repair	9
	Front Bumper	Misaligned	Repair	Repair Required
	Half Liftgate Trim Panel	Hole(S)	Report	1/2 To 1 Inch
	Hood	Corrosion	Repair	9 To 10 Inches
	Hood	Dent(S) W/No Paint Dmg	PDR	1 To 2 Inches
	Left Qtr Panel	Multiple Dents/Paint Damage	Repair	3
	Lift Gate	Multiple Dents/Paint Damage	Repair	2
	Left Front Door	Dent(S) W/No Paint Dmg	PDR	1/8 To 1/2 Inch
	Left Front Fender	Multiple Scratches Heavy	Touch Up	3
	Left Rear Door Panel	Hole(S)	Report	1/8 To 1/2 Inch

File Insurance Claim? - Additional Damages and Remarks: -

DISCLAIMER. THIS CONDITION REPORT IS FOR INFORMATIONAL PURPOSES ONLY AND IS BASED ON INFORMATION PROVIDED BY THE SELLER. THIS CONDITION REPORT IS NEITHER INTENDED, NOR SHOULD IT BE CONSTRUED TO CONSTITUTE, ANY TYPE OF WARRANTY, WHETHER EXPRESS OR IMPLIED, INCLUDING WITHOUT LIMITATION ANY WARRANTY OF MERCHANTABILITY, AND ANY SUCH WARRANTY, WHETHER ARISING BY OPERATION OF LAW OR OTHERWISE, IS HEREBY DISCLAIMED. ANY REPUBLISHING OF THIS CONDITION REPORT SHALL CONTAIN THIS DISCLAIMER.